









SHUMATI

SPRING

0445110095 Injector CRI1-13 Technical File

SPLERT

Standing S	s.
1.0445110095 Injector's Introduction	2
1.1. 0445110095 Injector's Basic Information	2
1.2. 0445110095 Injector's Common Part Number	2
1.3.0445110095 Injector's Matching Information	
1.4.0445110095 Injector's Parameter	
1.5.0445110095 Injector's Specifications and Dimensions	4
1.6. 0445110095 Injector's Quality Control	4
1.6. 0445110095 Injector's Quality Control	4
1.8.0445110095 Injector's Packing List and Package Size	5
1.9.0445110095 Injector's Testing Standard and Certificate	6
1 10 044E11000E Injector's Warranty Instructions	۵
1.10.0443110095 Injector's Manufacturer 2.0445110095 Injector Technical Support	7
2.0445110095 Injector Technical Support	8
2.1.0445110095 Injector's Part Number Location	8
2.2.0445110095 Injector's Application Scenarios	8
2.3.0445110095 Injector's Installation	8
2.4. 0445110095 Injector 's Reasons for Not Working Normally	9
2.4. 0445110095 Injector 's Reasons for Not Working Normally 2.5. 0445110095 Injector 's Causes of Damage	9
2.6.0445110095 Injector's Technical Support Obtaining Methods	
3.0445110095 Injector's Purchase and Delivery1	
3.1.0445110095 Injector's Purchase Payment Term13.2.0445110095 Injector's Main Sales Markets13.3.0445110095 Injector's Declaration Requirements1	0
3.3.0445110095 Injector's Declaration Requirements	0
3.4.0445110095 Injector's Shipping Ways	0
3.5.0445110095 Injector's Lead time	0
3.6.0445110095 Injector's Logistics Time for Destination Out of China's Areas	1
3.7.0445110095 Injector's Packing1	1
4.0445110095 Injector's Storage Standard1	
5. Company Information	3
5.1. Company Introduction	3
5.2. Sales-men's Contact Information1	4
5.2. Sales-men's Contact Information	4
. 20. 20. 20. 20. 20. 20. 20. 20. 20. 20	
AND TO	с. С
Du Du Du Du Du Du Du Du, Ju, Du, Du, Du, Du, Du, Du,	i
SANDALL	ş

Mob/WhatsApp: +86 13410541523 Email : <u>ruby@shumatt.com</u> © 2022 Shenzhen Shumatt Technology Co., Ltd

and a state of the state of the

. and

Tel: +8675523215133 Website : www.shumatt.com

Thus Thus Thus Thus

0445110095 Injector CRI1-13 Technical File

SPERA

SPORN

SHORE

3.^{7.10}

 $\mathfrak{g}^{[i]}$

1.0445110095 Injector's Introduction

-18⁻⁵⁰⁰ States Street Street Street 1.1. 0445110095 Injector's Basic Information

and Title and	China made new high quality diesel injector 0445110095 fuel injector CRI1-13							
SKU 1	G1W20445110095							
SKU 2	and a start a							
St. St. St.	이 일을 얻는 것을 같은 것을 걸음 것을 가지 않는 것을 걸음 것을 했다.							

1.2. 0445110095 Injector's Common Part Number

(1) Injector's Exchange Information

91 - 591	Injector Part Number	Re-manufactured Part Number	21 22
ite ite	0 445 110 096	0 986 435 063	Ten Ten
AND AND .	0 445 110 095	0 986 435 037	11 at 11 a
	0 445 110 201		_
ADDI' ADDI'	0 445 110 202	5 00° 5 00° 5 00°	and and
	cation Information	ster ster ster ster s	rr 3rr 3
Injector Part Number	MERCEDES-BENZ Car Model		
6" ST ST ST	613 070 05 87	stri stri stri stri s	r sr s
0 445 110 096	A 613 070 05 87	200 - 200 - 200 - 200	155 155
0.445.140.002	613 070 01 87	3 m 3 m 3 m 3	1
0 445 110 093	A 613 070 01 87	10 11 11 11 11	15 15
to and a star of	613 070 08 87	Strange Stores Stores 3	h ^{an} sh ^{an} s
A	A 613 070 08 87		
	A 613 070 08 87 80	and and and and and a	and all a
0 986 435 063	613 070 08 87 80		
astrant _astrant _	A 613 070 05 87	and the shift and the shift of	a and a start of
xy., 3xy., 3xy	A 613 070 05 87 80	20, 20, 20, 20	
. mar . mar .	613 070 08 87 0080	and and and and	and and
n - an - ar	A 613 070 08 87 0080	sm sm sm sm s	n 31 3
700 700	613 070 05 87	The The The The	- 10 - 10 -
ೆ ಇಲ್ಲ ತ	613 070 05 87 80	store store store a	N 38 3
0 445 110 095	613 070 05 87	D. D. D. D. D.	
and stranged at	A 613 070 05 87	Stope, Stope, Stope, Stope, S	New Steeling St
	613 070 01 87		
and and a	A 613 070 01 87	aller aller aller aller a	A CONTRACTOR OF
0 986 435 037	613 070 05 87		
all	A 613 070 05 87	and the set of the set	A DATE WARTEN
21. 20. 20	613 070 01 87	24. 24. 20. 20. 25	301. 30

Mob/WhatsApp: +86 13410541523 Email : ruby@shumatt.com © 2022 Shenzhen Shumatt Technology Co., Ltd

SHUMATT Shenzhen Shumatt Technology Co., Ltd

A 4	A 613 070 01 87	1 1 1 1	1 - 1 - 1	5 5
0 445 110 201	613 070 08 87		Stran Stran St	an share sh
<i></i>	A 613 070 08 87	1	a sa sa	
all all all a	A 613 070 05 87		all all all all all all	an ann an
	613 070 05 87			_
0 445 110 202	613 070 08 87	The second second	and a state of the second	and a start was
20. , 20. , 20	A 613 070 08 87	.Ar	30. 30. 30.	367, 367,
att att.	613 070 05 87	the state with	·	and a state of
51. S. S.	A 613 070 05 87	ster ster	STAL STAL	511 St.

(3) Injector's Part Number Common Writing

at 1 al la . A. al in the 0445110096, 0986435063, 0445110095, 0445110202, 0445110201, 0986435037, 0445110096, 0 986 435 063, 0 445 110 095, 0 445 110 202, 0 445 110 201, 0 986 435 037, 0 445 110096, 0 986 435063, 0445110095, 0445110202, 0445110201, 0986435037, 0445110096, 0986435063, 0 445110095, 0445110202, 0445110201, 0986435037, 0445110096, 0986435063, 0445110 095, 0445 110 202, 0445 110 201, 0986 435 037, 0445110 096, 0986435 063, 0445110 095, 0445110 202, 0445110 201, 0986435 037, 0445 110096, 0986 435063, 0445 110095, 0445 110202, 0445 110201, 0986 435037, A 613 070 05 87, A 6130700587, 613 070 05 87, 6130700587, 613 070 01 87, 6130700187, 613 070 08 87, 6130700887, A 613 070 01 87, A6130700187, A 613 070 08 87, A6130700887, 613 070 08 87 80, 613070088780, A 613 070 05 87 80, A613070058780, A 613 070 08 87 0080, A61307008870080, 613 070 05 87 80, 613070058780, A 613 070 08 87 80, A613070088780, 613 070 08 87 0080, 61307008870080 - Star -38

Vehicle brand	Series	Car Model	Engine Model	Production date	Power KW	Horse power	Emission Standard S	Manuf acturer	Emis sions (L)	Cylind er	Power SourceV
MERC EDES- BENZ	Sprinter	311 CDI Sprinter	OM 611.981 DE LA	2002/08 - 2006/05	80	109			2.1	4	12
MERC EDES- BENZ	Sprinter	313 CDI Sprinter	OM 611.981 DE LA	2000/04 - 2006/05	95	129			2.1	4	12
MERC EDES- BENZ	Sprinter	313 CDI Sprinter 4x4	OM 611.981 DE LA	2002/08 - 2006/05	95	129			2.1	4	12
MERC EDES- BENZ	Sprinter	211 CDI Sprinter	OM 611.981 D LA	2000/04 - 2006/05	80	109			2.1	4	12
MERC EDES- BENZ	Sprinter	213 CDI Sprinter	OM 611.981 D LA	2000/04 - 2000/05	95	129			2.1	4	12
MERC EDES- BENZ	Sprinter	313 CDI Sprinter 4x4	OM 611.981 D LA	2002/08 - 2006/05	95	129			2.1	4	12

1.3.0445110095 Injector's Matching Information

Mob/WhatsApp: +86 13410541523 Email : ruby@shumatt.com © 2022 Shenzhen Shumatt Technology Co., Ltd

MERC		411 CDI	ОМ	2000/04						
EDES-	Sprinter	Sprinter	611.981	-	80	109		2.1	4	12
BENZ		Sprinter	D LA	2006/05						

1.4.0445110095 Injector's Parameter

Adaptation System: Common Rail System
Injector Series: 110 Series

Parameter Performance: CRI1-13

Matching Accessories: /

Injector Type: Electromagnetic Injector

Support System Maximum Pressure: 1350 Vehicle Configuration Information: MERCEDES-BENZ

1.5.0445110095 Injector's Specifications and Dimensions

Injector Size: 21.5cm*4 cm *4 cm = 344cm³ (L*W*H=V) Injector Net Weight: 0.55kg Gross Weight: 0.6kg Injector Quality: China Made Brand New Package Size: 28cm*7 cm *7 cm = 1372 cm³ Injector Type: Diesel Common Rail Injector MOQ: 4 Pieces

1.6, 0445110095 Injector's Quality Control

(1) Injector Testing

All injector spare parts are tested for electrical characteristics, accuracy, high temperature, low temperature, withstand voltage, leakage, durability, and various working conditions.

(2) Injector Assembling

And the quality control of the injector production and installation process, our company strictly follows the standard product installation data and product installation steps to install, such as injector stroke test, injector solenoid valve tightening torque, injector nozzle tightening torque,

(3) Injector Inspection

- 28^{0,0}1

 $\mathbb{R}^{\mathbb{N}^{2^{n}}}$

The factory inspection of the injector is undergone full inspection, random inspection, and batch inspection three inspections. Different brands of test benches are used to test the same fuel injector for a total of no less than three times for factory inspection, and the fuel injector installation testing environment are progressed in dust-free workshop.

1.7. 0445110095 Injector's Customized Service

-2014

(1) Injector's Customized Service: Meet the customized needs of OEM manufacturers for shell lettering, logo engraving, injector internal packaging, injector external packaging and labels customized, etc.

Mob/WhatsApp: +86 13410541523 Email : <u>ruby@shumatt.com</u> © 2022 Shenzhen Shumatt Technology Co., Ltd



SPURAT			p	58 ⁷⁷ 51 ⁶
SPARAT	SIRV SIRV		а н на на н н на на н н на на н н н н н	anti shi
STUDET	Injector nozzle engraving	Injector house lettering and QR code	Injector box and label	17.51 1910

(2) Injector's Customized Service Requirements:

The purchased of customized injector are not less than 10 pieces. Customized injector packages no less than 1000 pieces.

Customized products involve the need of specify logo, the OEM manufacturer needs to provide trademark authorization and the sample of logo image file.

A Once the customized fuel injector is sold, it cannot be returned or exchanged if there is no quality problems.

1.8.0445110095 Injector's Packing List and Package Size

(1) Injector Spare Parts List

No.		2	
340	at at at at	Store Store	-SA - SA
sh ^{umige} sh ^{umig}		nt ^{ri} shu O shumit	an ^{ti} O ⁱ nte
Name	Fuel Injector	O-Ring	Gasket F 00V C17 503
Description	Fuel injector part number: 0445110095	Ensure to meet the standard of the sealing performance between the injector and the engine	Made of brass, used to ensure the tight fit between the injector cap end and the engine
No.	4 4	S 5	S 6 3 3
A Timage A Str		arr arr	sites and in
Name	Nozzle Protective Cover Cap	Injector House Protective Cover Cap	Solenoid Valve Protective Cap
Stor. Stor.	Protect nozzle holes from	Protect oil inlet from	Protect the solenoid valve body and
Description	being polluted and blocked	being polluted and blocked	terminals from being damaged by external forces
Description No.			
No.	being polluted and blocked	being polluted and blocked	external forces
And No.		being polluted and blocked	external forces

▲ Minors are forbidden to use the fuel injector assembly, O-ring, gasket, nozzle protective cover, fuel injector house protective cover, solenoid valve protective cover, VCI anti-rust bag, and air bubble bag to avoid personal injury.

• O-ring and gasket are disposable installation accessories, and need to be replaced for re-installation.


A The nozzle protective cover, the injector house protective cover, and the solenoid valve protective

Mob/WhatsApp: +86 13410541523 Email : <u>ruby@shumatt.com</u> © 2022 Shenzhen Shumatt Technology Co., Ltd

cover are recyclable accessories that can be reused.

VCI anti-rust bags and bubble bags are non-degradable materials, please dispose of them properly after using.

▲ The injector and the installation parts should be coated with appropriate sealing oil during installation.

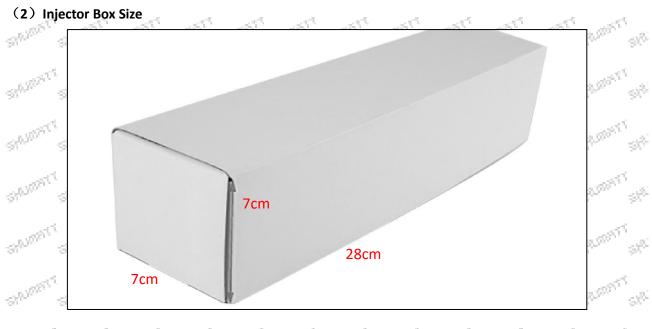

		<u> </u>	<u> </u>	and the			 	_
-33	No.	Name		Injector P	Package Size (c	m)		$\mathcal{J}_{\mathcal{G}}^{(i)}$
	1	Injector Box		10 (B)	28*7*7			1
	and the	- 20 - 20 ·	att att	Par Par	and and		 	-

1.9.0445110095 Injector's Testing Standard and Certificate

We can provide the factory quality inspection test report of each injector to ensure that each injector delivered meets the engine performance indicators.

	n. 30	2	<u> </u>	- 1994 - C	all	da e	Sec.	201	201	241	200
TEN	测试报告	4.05.201	9 10:42:09								
H企业:				100	r steine	57 SPLINE	STALLON STALLON	STALES	SAUDE	ari Status	57 17
9121 :	18址:			320	- A. 1990	Aller	add the second	- A.S.	- A.S.	A.S. 19	- 43
4 Ξ :	松潤人:			200	100	201	201	201	364	350.	200
en#15:											
5ið	送检单位。				đ	đ	a .	ari Silutai	17. 519.507	ari Stratte	17 ⊜¦\$3
ł¤:	客户姓名:		-	. 68	TT SPRINT	57 SPAINE	SPUTT	10 a. 10 a.	10 a dil	10 a di 1	1
KPRINIE:				200	Sec.	25	- 19 C	1979 - C	200	1997 - C.	- 377
(州名称:)	6 #25										
						-		_	-	~	
				32.575	STRUMP	TT SPORT	States	ari. Shutai	SPURI	Strate	17 31 ⁸³
21A.				133 M	183 M	- A.S.	- A.S.		- 13 ST	- 33.9°°	a the second
	检测结果	E		58 S. L	200	dian.	200	20.	2001	200	200
-00000 : 01088090 : 000000- 10166		excen contrat									
LEAK TEST: 32		es 20.82-11.6	~		A	- A	SILLER	1	10	19	10
Fade: at WARM: at		0 	-	15	STREET	ST SPORT	er ande	ST STUDI	an anan	ST. SHERE	17 38 ³
Mai: 2013		e)	~	40 ⁰⁰⁰⁰		Star .	- Star		53000	all and a second	- 20 ⁰⁰
TL: 364 LL: 160		0 ·····b·····	1						101-1	100 ⁻¹⁰	
VE: 42	4.5±1.8	o	*								
					STREET	57 - 5830F	S. State	an Anta	ST. SHEEL	ST. SWEET	1 ⁵⁷ 1979
				53.205		1	63 ⁹⁷	1	1	11	1
				300	- 93.5	-96-	- 53 Co.	681	- 32.00	- 682	- 335
11 02 02 04 住印前 重注册	desdesdesde8	6915.									
					er Steller	579,500	ST STREET	state	ST. SANTO	ST. SWITT	5 51
çe. Ş	it ^{yn} si	1,500 S	de an	1.00	100	1.10	- 10 M		- 1.5°	-4.20	

1.10.0445110095 Injector's Warranty Instructions

Mob/WhatsApp: +86 13410541523 Email : <u>ruby@shumatt.com</u> © 2022 Shenzhen Shumatt Technology Co., Ltd

 $\sim 10^{-1}$

(1) . Product Warranty Conditions and Instructions

It is necessary to provide pictures, videos, or test reports detected by the injector inspection equipment when the injector is abnormal during use as evidence to feed back to the salesman.

Abnormal conditions are properly explained such as: 1.Smoke, 2. Engine shake, 3. Difficulty starting the engine, 4. Engine noise, 5. oil leakage etc.

(2) . Injector Warranty Coverage

 $\mathcal{A}^{(2)}(t)$ Within 15 days after customer receives the 0445110095 injector, if there is a performance failure and المراجعة the product has no appearance damage, customer can choose to replace it or repair it;

If the 0445110095 injector has performance problems during the warranty period (3 months), and it is confirmed that it is product's problems after testing, you can contact our salesmen to replace the same model or a reworked product with the same performance for free;

If the injector house has obvious scratches, it can only be repaired and it will be returned as it is if the product is confirmed to be fault-free.

A Tips: For products not covered by warranty, our company can provide paid maintenance services. For products after paid repaired, the same performance problem will have a free warranty period within 3 months from the date of repairing. 100 STREET, STREET, STREET, STREET,

(3) . Injector Out of Warranty Coverage

The warranty period has expired.

Injector failure caused by high temperature, high pressure, humidity, rain and snow, saline-alkali land, earthquake, and used in abnormal environment.

Customer disassembles or repairs the injector personally resulting in damage to the injector.

Injector damage caused by man-made reasons (throwing, strong magnetic field magnetization, set fire). Injector failure or injector damage caused by non-injector design, technology, manufacturing, quality THE A DEAL A DEAL A DEAL A DEAL A DEAL and other issues.

Injector failure due to system pressure exceeding system approved pressure.

Injector failure caused by system voltage exceeding approved voltage.

Injector failure caused by impurities (water, lead, aluminum powder, iron powder, sulfide) in the system fuel exceeding the standard requirements.

Injector failure caused by not installing according to the tightening torque specified in the vehicle engine maintenance manual (the tightening torque is too large or too small).

Injector failure caused by not following the installation angle specified in the vehicle engine maintenance - Stall -18-50° " States, States, States, States, States, A.S. manual.

Injector failure caused by not following the cleaning requirements specified in the vehicle engine NEEL maintenance manual. OF T

Injector failure caused by failure to replace consumable parts as specified in the vehicle engine maintenance manual. d Da d 1 -

Injector failure caused by not complying with the intake system fit clearance and exhaust system fit clearance requirements specified in the vehicle engine maintenance manual.

Failure to replace the consumable parts and the fitting clearance of the oil inlet system pipeline and the fuel injector connection in accordance with the fuel intake system specified in the vehicle engine maintenance manual.

1.11.0445110095 Injector's Manufacturer

Injector's manufacturer: Shenzhen Shumatt Technology Co., Ltd

Mob/WhatsApp: +86 13410541523 Email:ruby@shumatt.com © 2022 Shenzhen Shumatt Technology Co., Ltd

as^{neri}ta 2.0445110095 Injector Technical Support

2.1.0445110095 Injector's Part Number Location

1) E.g.: The injector part number see as follows




. 1	No.	Name
lan.	- ST - ST	brand, logo, part number,
	A	series number
10	B.	nozzle part number
for.	310. 31	31 31 31 21

CALIFORN .

SALDAT

-31^{0,008} 2.2.0445110095 Injector's Application Scenarios

Common rail system is an oil supply method refers to the diesel oil from the fuel tank sucked out by the gear pump through the oil-water separator and the gear pump to diesel fine filter, high-pressure pump, common rail pipe, and fuel injector, all together with the closed-loop fuel supply system composed of sensors and ECU that completely separates the generation of injection pressure and the injection process from each other.

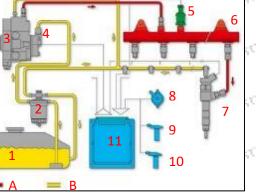



and the	and and	li Ali	Pic Pic	: No. 1	all all the set	anti a	and a and a
No.	Name	No.	Name	No.	Name	No.	Name
-Aller C	Tank	् दुर्जुले	Common Rail Pressure Sensor	9	Engine Crankshaft Sensor	Â	High Pressure Oil Circuit
2	Diesel Filter	6	Common Rail Pipe	10	Camshaft Sensor	B	Low Pressure Oil Circuit
300	High-Pressure Pump	7.0	Injector	31 ²⁰	ECU Electronic Control Unit	19 ⁵³ -28	1997 - 33,1997 - 38
4	Fuel Gear Pump	8	Accelerator Pedal			- 10° - 1	

Pic No. 1

2.3.0445110095 Injector's Installation (1) .0445110095 Injector's Installation Precautions:

A The replacement of the fuel injector must strictly follow the electrical system, the approved pressure of the low-pressure fuel intake system, the approved pressure of the high-pressure fuel circuit system, and fuel system replacement consumables requirements (including the low-pressure fuel circuit system filter and the high-pressure fuel circuit) specified in the vehicle engine maintenance manual,

A Replacement of wearing parts of the fuel system, cleaning requirements for the connection between the fuel system and the injector, the fitting clearance of the fuel injector connection, the installation angle and

Mob/WhatsApp: +86 13410541523 Email:ruby@shumatt.com © 2022 Shenzhen Shumatt Technology Co., Ltd

tightening torque of the injector, the fitting clearance of the intake system, and the fitting clearance of the exhaust system to ensure the service life of the engine and the normal operation of the injector. When installing the fuel injector on the engine, it is necessary to clean the engine block, cylinder head and other parts connected to the fuel injector, and ensure that there is no dust, carbon deposits, water, rust

 $\sim \phi^{2/2}$ spots, etc.

A Before installing, check whether the fuel injector nozzle gasket has been replaced and installed on the STATE STATE STATE STATE STATE STATE STATE STATE fuel injector.

When installing the fuel injector, apply lubricant between the fuel injector, fuel nozzle sealing gasket and O-ring, The second a and the

Without replacing new gasket can lead to: deformation of the tight cap of nozzle, deformation of nozzle, deformation of nozzle orifice, oil leakage and air leakage, which will cause serious damage to the fuel injector and nozzle to break and cause damage to the engine.

A When installing the injector on the engine, please carefully check the components related to the installation of the injector, such as the injector pressure plate, screw, injector rod and other accessories are not deformed, and install it in strict accordance with the operation steps of the engine maintenance manual. It is forbidden to operate the bare injector for a long time in an environment with serious dust pollution and corrosion to iron products. -SAUDA $\mathcal{D}^{\mathbb{N}_{+}}$

It is forbidden to operate the bare injector for a long time in a strong magnetic field environment.

2.4. 0445110095 **Injector 's Reasons for Not Working Normally** (1) There is air in the cill circuit.

(1) There is air in the oil circuit of the engine fuel system.

(2) Vehicle oil pump oil supply system is not normal.

ahi^{ngh} (3) Engine common rail system oil leakage or pressure limiting valve damage.

(4) There is a short circuit, cutting out and poor contact in the wiring harness connected to the fuel injector - sthat 57^{8,300} Star . of the vehicle.

(5) The long-term placement of the injector causes the anti-rust oil to solidify, and the internal components SANDAR C SPARTER T are stuck or the oil holes are blocked.

Before installing, carefully check whether other components in the common rail system except the fuel injector are damaged so as to prevent the fuel injector from not working properly after being replaced. Stream Stream Stream

2.5. 0445110095 Injector 's Causes of Damage

(1) Didn't operate properly according to engine maintenance manual during disassembly or installation, resulting in damage to the injector .

(2) The fuel oil used for the vehicle does not meet the standard cause damage to the injector, such as the water content in the fuel oil exceeds the standard, iron powder, aluminum powder, sulfide impurities exceed the standard, etc.

(3) The engine is not regularly maintained according to the engine maintenance manual (please refer to the vehicle maintenance manual for the maintenance mileage). For example, failure to replace the lubricating oil of the engine system for a long time will cause abnormal wear of the engine, excessive exhaust gas volume or a large amount of carbon deposits inside the engine. The filter is not replaced during maintenance or the replaced filter cannot reach the original filter standard. all above reasons can cause damage to the injector.

(4) The abrasion of the oil pump produces iron powder and aluminum powder enter the fuel injector and cause damage to the fuel injector.

(5) The deformation and abrasion of fuel tank result in iron powder or aluminum powder entering the fuel

injector and causing damage to the fuel injector.

(6) The fuel injector is damaged due to replacement or adjustment of the relevant parts of the fuel injector. For example, the valve clearance does not meet the standard after the engine is repaired, the replacement or modification of the wiring harness connected to the injector fails to meet the original standard.

- (7) The engine is overheated and overloaded for a long time working results in damage to the fuel injector.
- (8) The injector will be damaged naturally at the end of its working life.

(9) The injector is magnetized (injector parts' magnetic exceeded) causing the injector to not work properly. A Before replacing the fuel injector, please check the engine parts carefully according to the engine maintenance manual to avoid the fuel injector being damaged again after replacement.

2.6.0445110095 Injector's Technical Support Obtaining Methods

- (1) Injector Technical File, visit http://shumatt.com to get the technical file.
- (2) Injector Technical Videos

25⁵ 100 and. Facebook: Visit https://www.facebook.com/hison.li to get the technical videos, constantly follow can get more information.

YouTube: https://www.youtube.com/channel/UCByvYBx7VjV_mAfxh_Hu-aw to get the technical videos, constantly follow can get more information.

Shumatt: Visit <u>http://shumatt.com</u> to get the technical videos.

(3) Injector Information Query Software

TruckBook Parts EPC APP, Android/Apple App Store download and install, visit http://shumatt.com to get the download and installation tutorial

(4) Search The fuel injector test data through TruckBook Parts EPC APP.

100

3.0445110095 Injector's Purchase and Delivery 17 Page $\mathcal{P}_{\mathcal{P}_{\mathrm{S}}}$

and the and the second 3.1.0445110095 Injector's Purchase Payment Term

Payment Terms: T/T, PayPal, Alipay, WeChat

Please contact our salesmen for specific payment information.

3.2.0445110095 Injector's Main Sales Markets

120 d de Injector main sales markets: Asia, Europe, North America, South America, Africa etc.

3.3.0445110095 Injector's Declaration Requirements

anti la Shumatt can assist customers to provide the following documents for import customs clearance: contract, invoice, packing list, bill of lading, insurance policy, certificate of origin, etc. A STORY 2.5055 2.555.21 2.20 5 1

3.4.0445110095 Injector's Shipping Ways

Destination in China areas: SF Express, Debon Express, the corresponding logistics company can be provided Sh Sor $S^{h^{2D}}$ according to customer requirements in special cases. Destinations out of China's areas: DHL, UPS, FedEx, TNT air, ocean or other shipping methods required by customers.

3.5.0445110095 Injector's Lead time

Mob/WhatsApp: +86 13410541523 Email:ruby@shumatt.com © 2022 Shenzhen Shumatt Technology Co., Ltd

Lead time: Send out within 3 – 7 working days after receiving payment (Except for special products and SRIDA SALER SPIRET SPATTERS S. M. DER special cases).

Country or Region of Departure China's Mainland		Hong Kong China	Other Countries or Regions of Asia 7 Days	Australia and Zealand	New Europe	Europe	America	Other Countries 7-10 Days
		7 Days		8 Days	30.0	8 Days	8-12 Days	
PS Logistics T	ime: Co	ountry o	r Region of Departure	e: China's Ma	inland	de a	di sa	de al
Country of Destination	Estima Arrival 1		Country of Destination	Estimated Arrival Time	Cou	ntry of Desti	nation	Estimated Arrival Time
Japan	3 Day	/s	ST UK ST	5-7Days	e	Egypt		5-7 Days
Turkey	5-7 Days		Singapore	3 Days	Switzerland		5-7 Days	
Bahrain	5-7 Days		Latvia	7-10 Days	New Zealand		7-10 Days	
Sri Lanka	5-7 Days		Thailand	3 Days	Austria		5-7 Days	
Romania	5-7 Days		Vietnam	3-5 Days	Estonia		5-7 Days	
Malaysia	3-5 Days		Strael and	5-7 Days	Mexico		5 ⁵¹	7-10 Days
France	5-7 Days		America	5-7 Days	United Arab Emirates		5-7 Days	
Italy	5-7 Days		Netherlands 5-7 Days		Bengal	15 - d	7-10 Days	
Lebanon	banon 5-7 Days		Philippine	3-5 Days	Greece State		3200	7-10 Days
South Korea	South Korea 3 Days		Spain 5-7 Days Myanmar		1	5-7 Days		
Canada	ada 5-7 Days		Germany	5-7 Days	Saudi Arabia		a	7-10 Days
Portugal	5-7 Days		Australia	5-7 Days	South Africa		a	7-10 Days
Denmark	Denmark 5-7 Days		Belgium	5-7 Days	-7 Days Ukraine		S. 4.2	7-10 Days
India	India 7-10 Days		Qatar	7-10 Days	7-10 Days Poland		20. r	5-7 Days
Indonesia	3-5 Da	iys	Morocco	7-10 Days	1	Pakistan	1	7-10 Days
Kuwait	7-10 D	avs	- 98° - 98° - 9	an silan	3100	Star.	5000	Store .

3.6.0445110095 Injector's Logistics Time for Destination Out of China's Areas

The logistics time is for reference only, subjects are according to the actual arrival. 519.5⁹³ SPUTT SH158 All All and 49° - 49°

3.7.0445110095 Injector's Packing

Domestic express packaging: Usually wrapped in waterproof scotch tape, such as picture No.2. International express packaging: Wrapped with waterproof yellow tape After wrapping the black protective film, such as picture No. 3.

Pallet Shipping: Use fumigation free and recycling trays that meet export requirements, and use white wrapping protective film to wrap and bind with cable ties for the outside, such as picture No. 4, STATIST SPLEINT

also, the products can be packaged according to customers' requirements.


The packing tray is made of plastic and can be recycled.

Transparent tape, yellow tape, black wrapping protective film, white wrapping protective film are non-degradable materials, please dispose of them properly. SALEST

Minors are prohibited from using transparent tape, yellow tape, black wrapping protective film, and SPANNER white wrapping protective film to avoid personal injury.

and a state of the state of the

Mob/WhatsApp: +86 13410541523 Email:ruby@shumatt.com © 2022 Shenzhen Shumatt Technology Co., Ltd

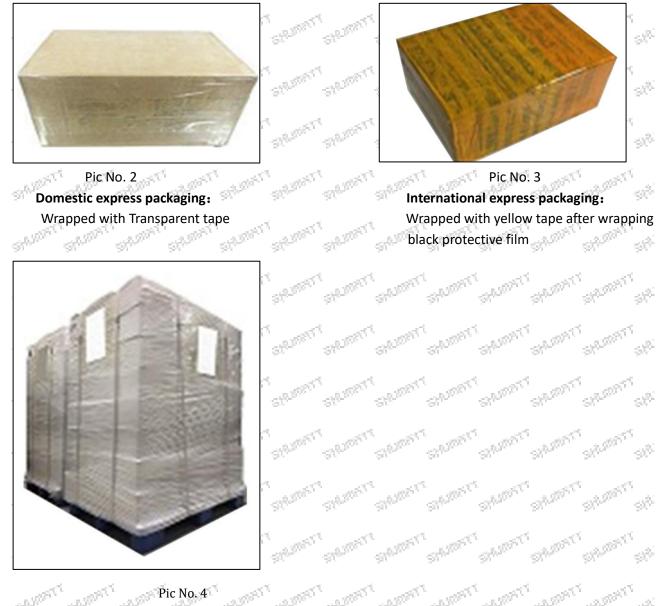

Pallet Shipping: Use pallet that meet export requirements, and use white wrapping protective film to wrap and bind with cable ties and and a start and the

4.0445110095 Injector's Storage Standard

(1) Choose a suitable storage place

1795 The warehouse and cargo yard where the fuel injector is stored should be kept clean and dry, and away from the factory buildings that generate harmful gases and dust; do not mix with acid, alkali, salt and other substances; the storage place should have a good drainage system; the cargo yard should be flattened with gravel or furnace ash etc. to enhance the water permeability of the surface layer to keep the reservoir area dry. $\otimes^{\mathbb{N}^{[j]}}$ States.

(2) Strict requirements of warehousing

Strict inspections should be carried out when the fuel injectors are put into storage, the surface cleaning work should be done well to remove water traces, oil stains, ash and other dirt, remove the rust and do antirust treatment in time. Packaged injectors must be protected from damage.

(3) Keep the warehouse dry and preventing moisture

Mob/WhatsApp: +86 13410541523 Email:ruby@shumatt.com © 2022 Shenzhen Shumatt Technology Co., Ltd

Tel: +8675523215133 Website : www.shumatt.com 1.000 C

The relative humidity is usually below 70% for the fuel injectors placed in the room, and the corrosion of the fuel injectors is significantly reduced.

Injectors must be stored in the warehouse, and they are forbidden to store in the same warehouse with commodities with high water content.

(4) Stack Properly

After the injector is exposed to rain, the corrosion rate will increase significantly. The purpose of sealing is to isolate the injector from rainwater and humid air, so the warehouse window should be checked in time to avoid rainwater entering the warehouse

If the fuel injector package is damaged, it should be repaired or replaced; when the package is damp, the packaging material should be dried; if the original anti-corrosion and oil applied at the factory is found to be damaged or dried up, it should be cleaned and re-applied oil in time.

- **A** It is forbidden to leave the injector exposed in the air for a long time.
 - It is forbidden to store acid, alkali, salt and other substances together with the injector.
 - A The unpacked fuel injector must be rust-proof during secondary storage.

5. Company Information



Mob/WhatsApp: +86 13410541523 Email : <u>ruby@shumatt.com</u> © 2022 Shenzhen Shumatt Technology Co., Ltd

Email: ruby@shumatt.com

Website: www.shumatt.net

Shenzhen Office: 11-12, Floor 14, Building 13, Qinchengda Building, Exit A, Honglang North Subway Station, Bao'an District, Shenzhen, China's Mainland

Shenzhen Office: Room 428-430, Building B, Huafeng Zhigu Technology Industrial Park, Exit B, Fuyong Metro Station, Bao'an District, Shenzhen, China's Mainland

♥ Hong Kong Office: Jianfa Street Industrial Zone, Tuen Mun, New Territories, Hong Kong, China

• After-sales Service Address: Please contact our salesmen to obtain and provide the corresponding product maintenance reasons (Reference: <u>1.10.0445110095 Injector Warranty Instructions</u>)

No.	Name	WeChat/WhatsApp	WeChat/WhatsApp Email		YouTube
1	Ruby	+86-13410541523	ruby@shumatt.com	Hison Li	Hison Li
2	lvy	+86-18025299821	sales@shumatt.com	Ivy Shumatt	Shumatt IVY
3 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	Rebecca S	+86-18025349821	sales01@shumatt.com	Rebecca SHUMATT	SHUMATT Rebecca
4	Janny	+86-18028749821	sales02@shumatt.com	Janny shumatt	Janny Shumatt
5	Sam	+86-13316859821	Sales8@shumatt.com	Shumatt Sam	Sam Shumatt
6	Natalie	+86- 18938945856	sales15@shumatt.com	Shumatt Natalie	Lin Natalie
7	Ada	+86-1342286353	sales5@shumatt.com	Shumatt Ada	Ada Shumatt
8	Hison Li	+86-18318811871	web@shumatt.com	Hison Li	Hison Li
9.00	Mecca	+86-18938948618	sales11@shumatt.com	Shumatt Mecca	Shumatt Mecca
10	Eric S	+86 18319033618	sales3@shumatt.com	Store Store	- 91° - 91°
11	Wayne (Joaquín en español)	+86-13316959821	wayne@shumatt.com	shumattwayne	Wayne Shumatt
12	Sylvia	+86 18312499884	sales6@shumatt.com	1. 18 18 M	and the second
31	- 91 91 91.	Visit http://shumatt.com to ob	tain the latest information of sales-m	ien St	- 90° - 90°
		PS: Shumatt's sales-men's e	mails are all end with @shumatt.com	า	

5.2. Sales-men's Contact Information

6. Copyright Statement

The copyright of any contents (including but not limited to parameters, data, text, charts, images, sounds or videos, etc.) provided in "0445110095 *Injector* CRI1-13 *Technical File*" belong to Shenzhen Shumatt Technology Co., Ltd. Without the prior written permission of Shenzhen Shumatt Technology Co., Ltd., you are not allowed to modify any contents in "0445110095 *Injector* CRI1-13 *Technical File*" in any way. At the same time, any conditions to spread, re-post, display the contents of "0445110095 *InjectorCRI1-13Technical File*" should indicate that the cited article is from Shenzhen Shumatt Technology Co., Ltd., Any actions failure to follow above conditions to use "0445110095 *Injector* CRI1-13 *Technical File*" will violate the *"Copyright Law of the People's Republic of China"* and other laws and regulations and the provisions of relevant international parameters.

States.

SPACE

510.500

53.4.573

SPREEDENT

519.39505

conventions. $a^{\mu \prime}$

Mob/WhatsApp: +86 13410541523 Email : <u>ruby@shumatt.com</u> © 2022 Shenzhen Shumatt Technology Co., Ltd